

*NPCB Maintenance



* Customers can put some grease on pivot points (red circle place), with brass or gunmetal bushings.




WD-40 多种规格




* Let's maintain your machine!

NPCB.5 PARTS


A[1PCS]

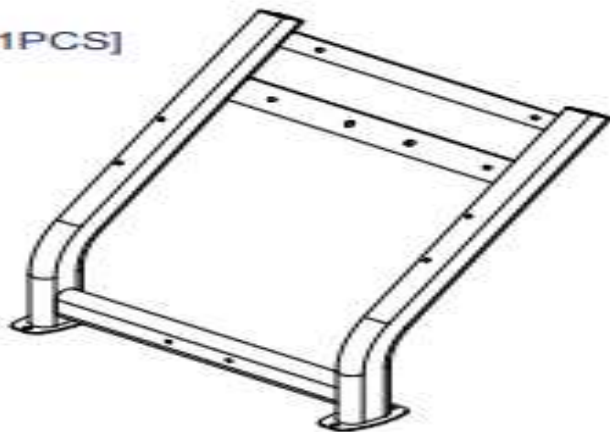

B[1PCS]

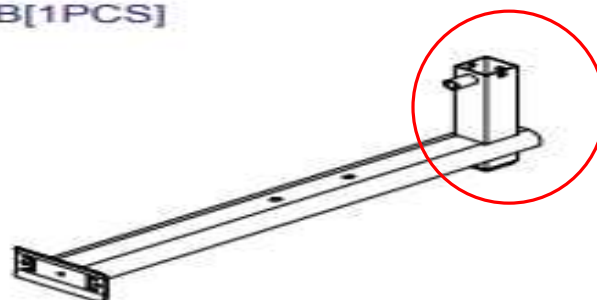

D[1PCS]

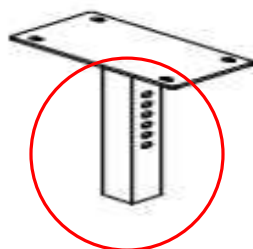

M[1PCS]
9131-044



N[1PCS]
9121-078



K[2PCS]
8323-234



O[2PCS]
9260-250



NPCB.5 PARTS

D3.50X100 END CAP (9211-193)		[3PCS]
D4.RUBBER INSERT (9310-076)		[2PCS]
D6.RUBBER STOPPER (9214-045)		[1PCS]
D7.□45X60 BUSHING (9211-047)		[1PCS]
D8.POP PIN (8250-065G)pre-installed		[1PCS]

D3



D4



D6




D7




D8



Above shows STEP 1
assembled and completed

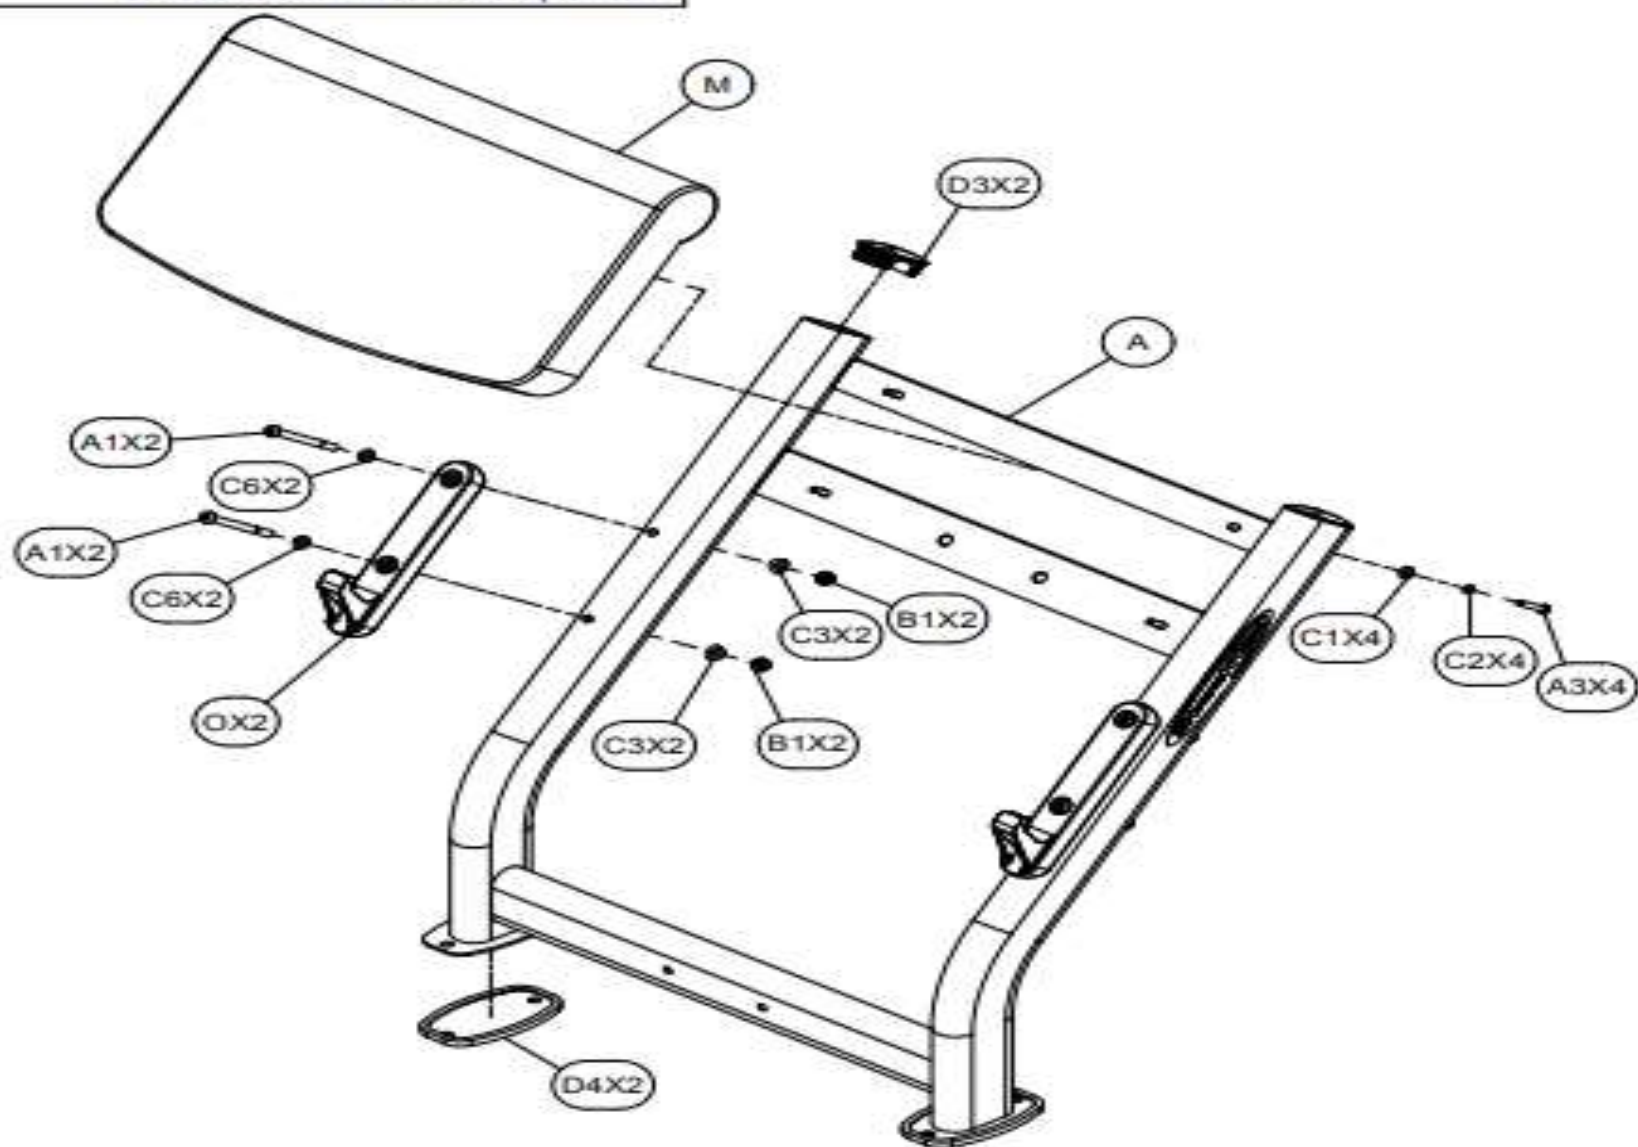

Above shows STEP 2
assembled and completed

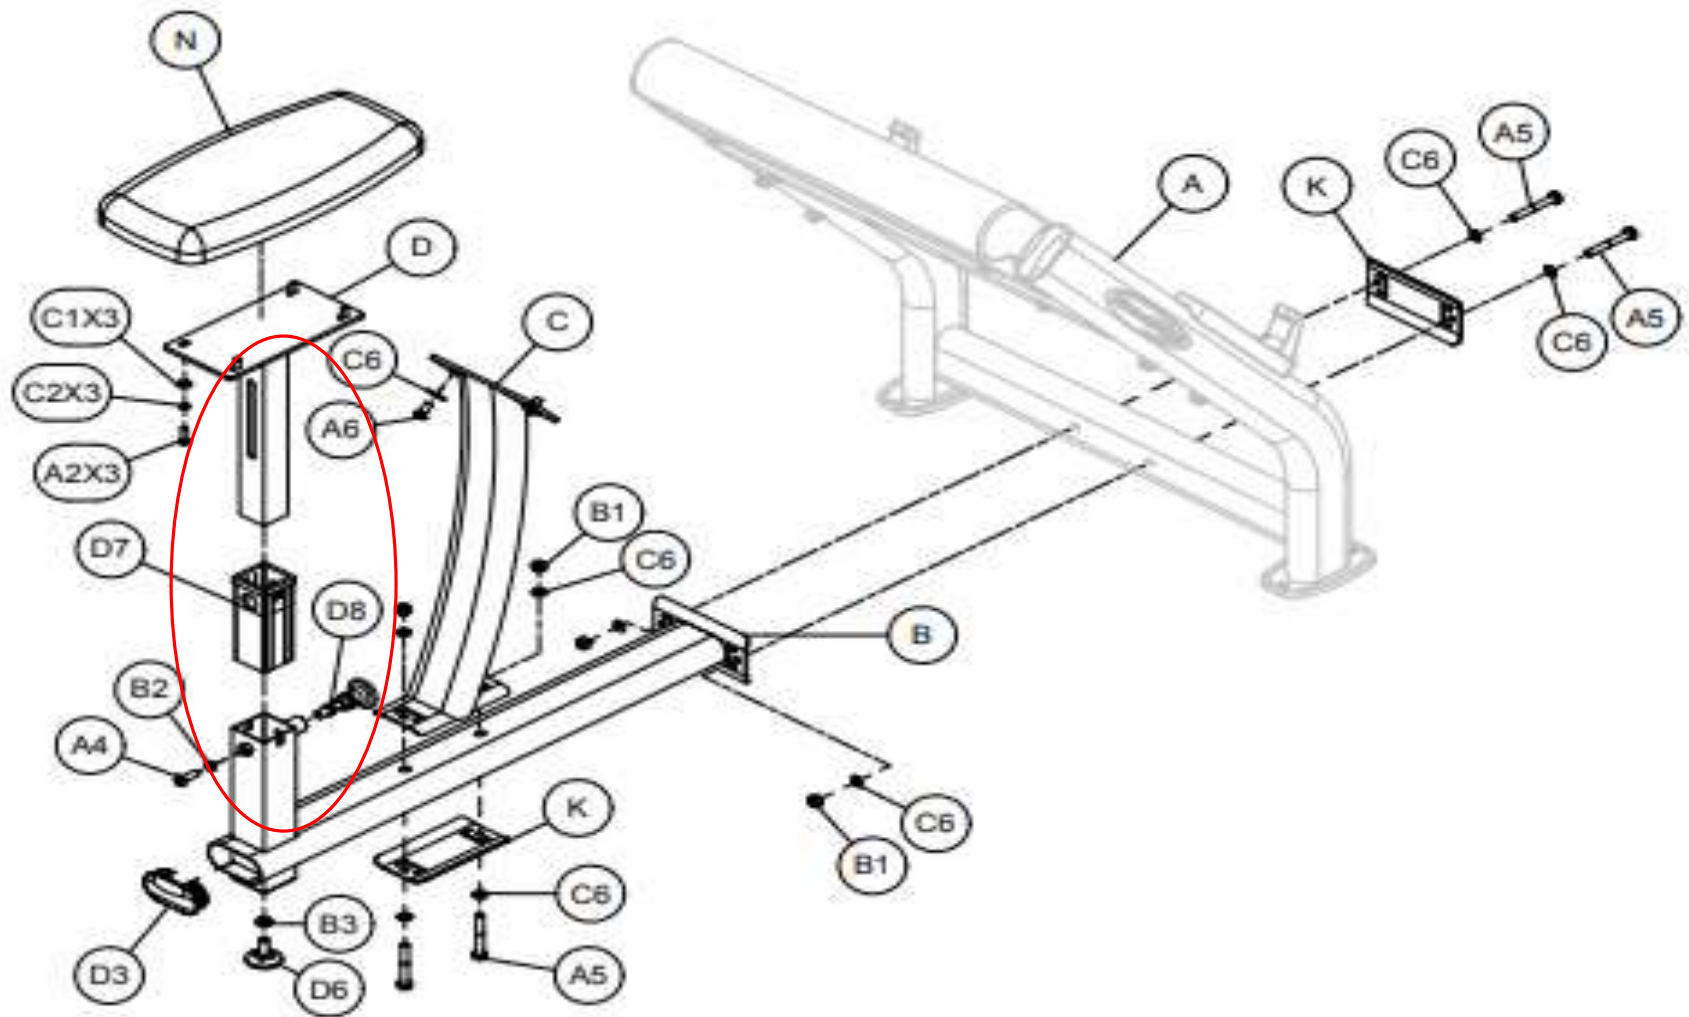

*Well done!

